


# Visual Health Check

<b>Name</b>	James Middlebrooke	<b>Mileage</b>	21000.0	<b>Date</b>	27 Aug 2010
<b>Vehicle</b>	BMW, 1 Series	<b>Registration</b>	KG58GYI	<b>MOT due</b>	11 Aug 2011
<b>Telephone</b>	01216042011	<b>Job Number</b>	14698C	<b>Service Due</b>	11 Aug 2011
<b>Mobile</b>	07811185413	<b>Vehicle Identity</b>		<b>Timing Belt Due</b>	11 Aug 2013

**As part of this visual appraisal, these areas of your vehicle were inspected:**

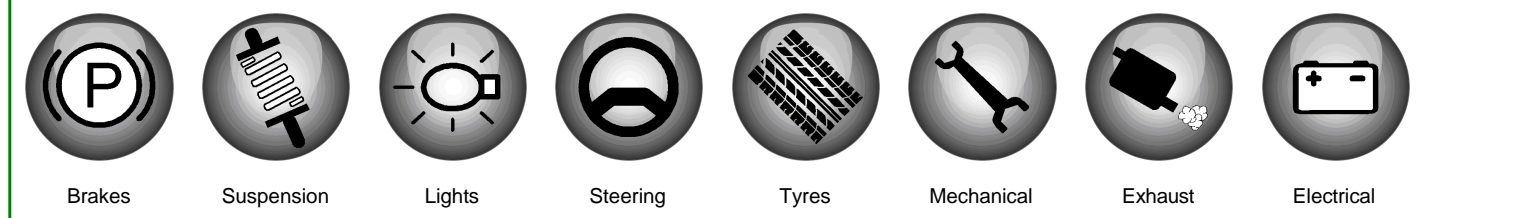

**Red Items:** These items require your urgent attention.

Category	Description	Recheck	Auth	Fitted Price
Electrical	Electrical, Brake Lights, Not working, Advise <b>Tech Note:</b> Intermittent fault		✓	£52.88
Mechanical	Mechanical, Engine oil, Low, Advise <b>Advisor/Parts Note:</b> In stock		✓	£18.22

**Amber Items:** These items will require your attention in the near future.

Category	Description	Recheck	Auth	Fitted Price
Brakes	Brakes, Brake Pads, Front, Worn 60-70%, Advise <b>Tech Note:</b> Slightly lipped condition <b>Advisor/Parts Note:</b> Stock arriving PM		✓	£193.88
Mechanical	Mechanical, Pollen filter, Contaminated, Replace <b>Advisor/Parts Note:</b> Free Fitting <b>Part Numbers:</b> #22FHG POLL, #453FD POLL		✓	£14.10

<b>Authorised</b>	<b>Identified</b>
£279.08	£279.08

**Additional Notes:**

Front tyres 47% worn. Call back in 6 months for a complimentary Vehicle Health Check.

Tyre Report		Left	Middle	Right	Wear
Nearside Front	Tyre	5mm	5mm	5mm	47%
Offside Front	Tyre	5mm	5mm	5mm	47%
Offside Rear	Tyre	7mm	7mm	7mm	16%
Nearside Rear	Tyre	7mm	7mm	7mm	16%
Spare	Sealant	0mm	0mm	0mm	

Tyre Sizes	
Front	195/30 R18 75VR Yokohama
Rear	195/30 R18 75VR Yokohama

**Healthcheck Approval**

Technician:  Ian Brown

Service Contact: David Mason

Customer:  The details above have been brought to my attention.